


| ITEM | CODE | DESCRIPTION | QUANT | UNIT |
|------|------|--|-------|------|
| 446 | 6010 | CLEAN & PAINT EXIST STR (SYSTEM I-A) | 1 | LS |
| 401 | 6001 | FLOWABLE BACKFILL | 3 | CY |
| 429 | 6023 | CONC STR REPAIR (PAN GIRDER HOLE REPR) | 168 | EA |
| 427 | 6006 | EPOXY WATERPROOF FINISH | 360 | SF |

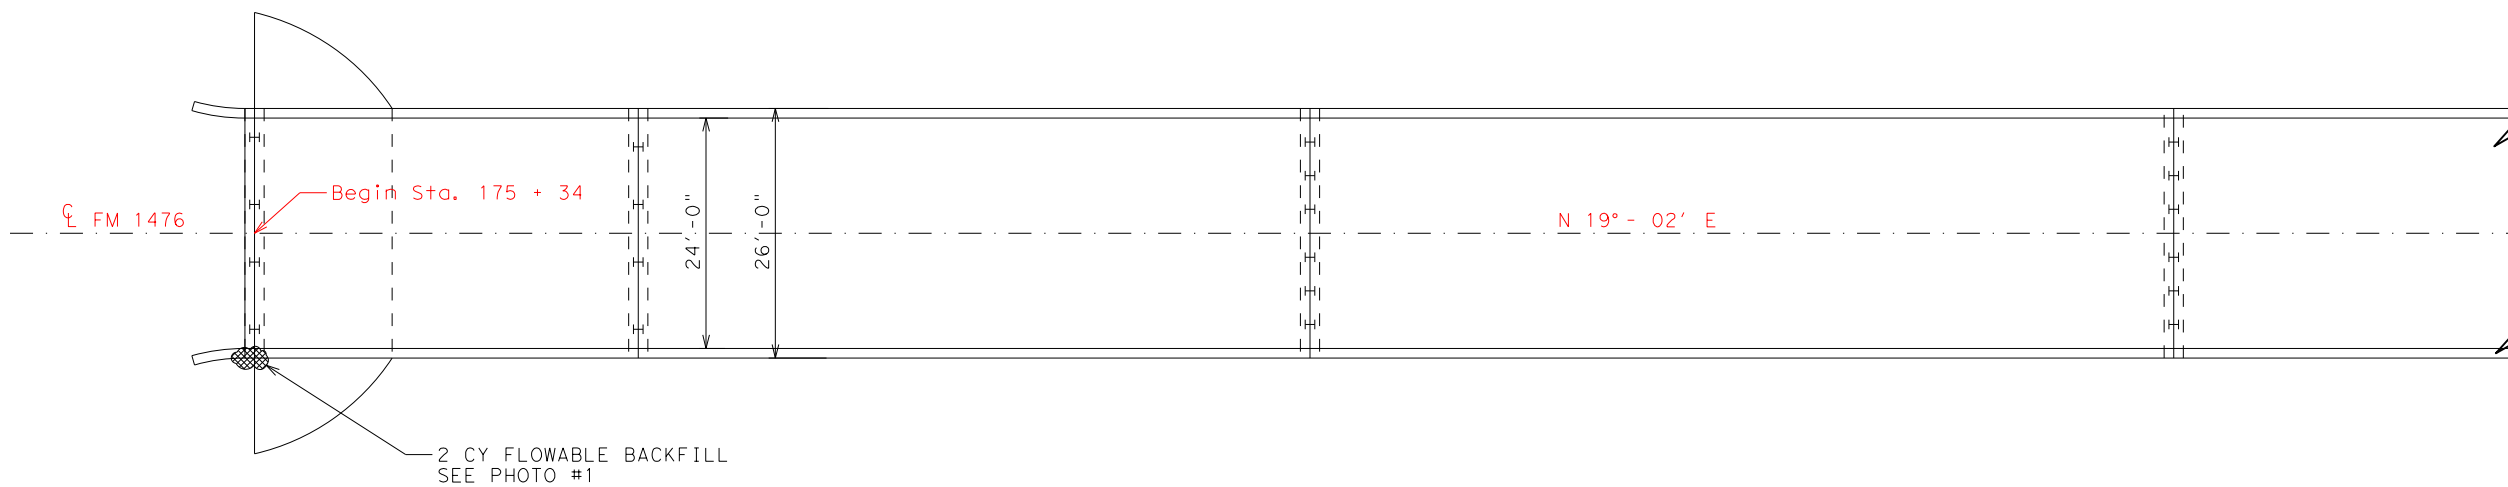

NOTE: REPAIR PAN GIRDER HOLES USING PAN GIRDER REPAIR DETAILS IN ACCORDANCE WITH ITEM 429.

EXTERIOR GIRDERS SHALL BE CLEANED, PREPARED, AND FINISHED AT ALL EXTERIOR DRAIN HOLES AS DIRECTED BY THE ENGINEER. THIS WORK IS ESTIMATED AT 10 SF PER EXTERIOR DRAIN HOLE, AND SHALL BE PERFORMED IN ACCORDANCE WITH ITEM 427, SURFACE FINISHES FOR CONCRETE.

NOTE: BEAMS, DIAPHRAGMS, AND BEARINGS SHALL BE SPOT CLEANED AND PAINTED IN ACCORDANCE WITH ITEM 446 UP TO 300 SF.

Sta. 175+34 - 180+04
 3 Span Continuous Steel Unit on Concrete Pipes & 6 Simple Reinforced Concrete Pan Girder Spans On Steel Pile bents



Note: Embankment erosion has undermined top of concrete riprap at SE corner approx. 3'.

PHOTO #1

DATE: 20 AUG 2019
 COUNTY: 047
 CONT-SEC: 1039-02
 STR: 014

UNDERMINING RIPRAP SE CORNER
 Looking N
 IMG. 0704



Note: Embankment erosion has undermined top of concrete riprap at NE corner approx. 2', causing the top corner of riprap to break away.

PHOTO #2

DATE: 20 AUG 2019
 COUNTY: 047
 CONT-SEC: 1039-02
 STR: 014

UNDERMINING RIPRAP NE CORNER
 Looking SE
 IMG. 0700

This document is released for informational purposes under the authority of:
 Dan A. Hohmann, P.E.
 Engineering Seal #97588
 8/31/2021
 It is not to be used for regulatory approval, permit, bidding, or construction purposes.

FM 1476 @ LEON RIVER
 230470103902014
 COMANCHE CO.



| CONT | SECT | JOB | HIGHWAY |
|------|----------------|-----------|-------------|
| 0288 | 01 | 039, etc. | SH 16, etc. |
| DIST | COUNTY | | SHEET NO. |
| BWD | COMANCHE, ETC. | | 76 |

DATE: 8/31/2021 11:25:25 AM
 FILE: T:\BWD\SGTEAM\Jacob Perry\Bridg Maintenance Contract FY21\FM 1476 LEON RIVER.dgn

DNE: []
 CK: []
 DW: []
 CK: []