


ITEM	CODE	DESCRIPTION	QUANT	UNIT
429	6007	CONC STR REPAIR (VERTICAL & OVERHEAD)	8.0	SF
4002	6001	REPLACE ELASTOMERIC BEARING PADS	1.0	EA
495	6001	RAISING EXIST STRUCT	1.0	LS
438	6002	CLEANING AND SEALING EXISTING JOINTS(CL3)	644.0	LF
446	6028	SPOT CLEAN & PAINT EXIST STR(SPL PRT SYS)	1.0	LS


NOTE: DECK CLEAN AND SEAL EXISTING JOINTS AT ALL JOINT LOCATIONS IN ACCORDANCE WITH ITEM 438. USE DETAIL "B" ON THE CLEANING AND SEALING EXISTING BRIDGE JOINTS REPAIR DETAILS FOR REFERENCE.

SPOT CLEAN AND PAINT BEARINGS AND DIAPHRAGMS (EVERY OTHER JOINT) IN ACCORDANCE WITH ITEM 446 UP TO 300 SF.

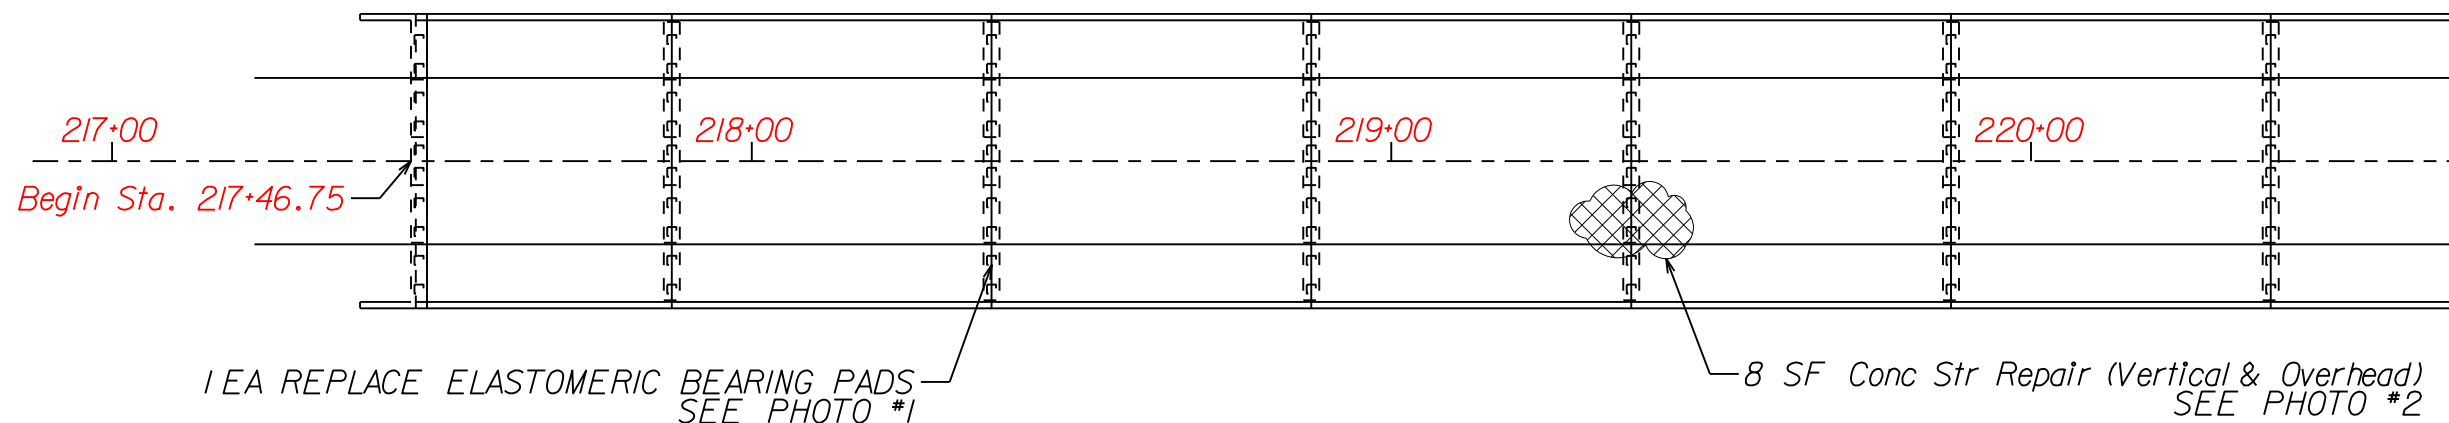

1 EA REPLACE ELASTOMERIC BEARING PADS
SEE PHOTO #1

8 SF Conc Str Repair (Vertical & Overhead)
SEE PHOTO #2

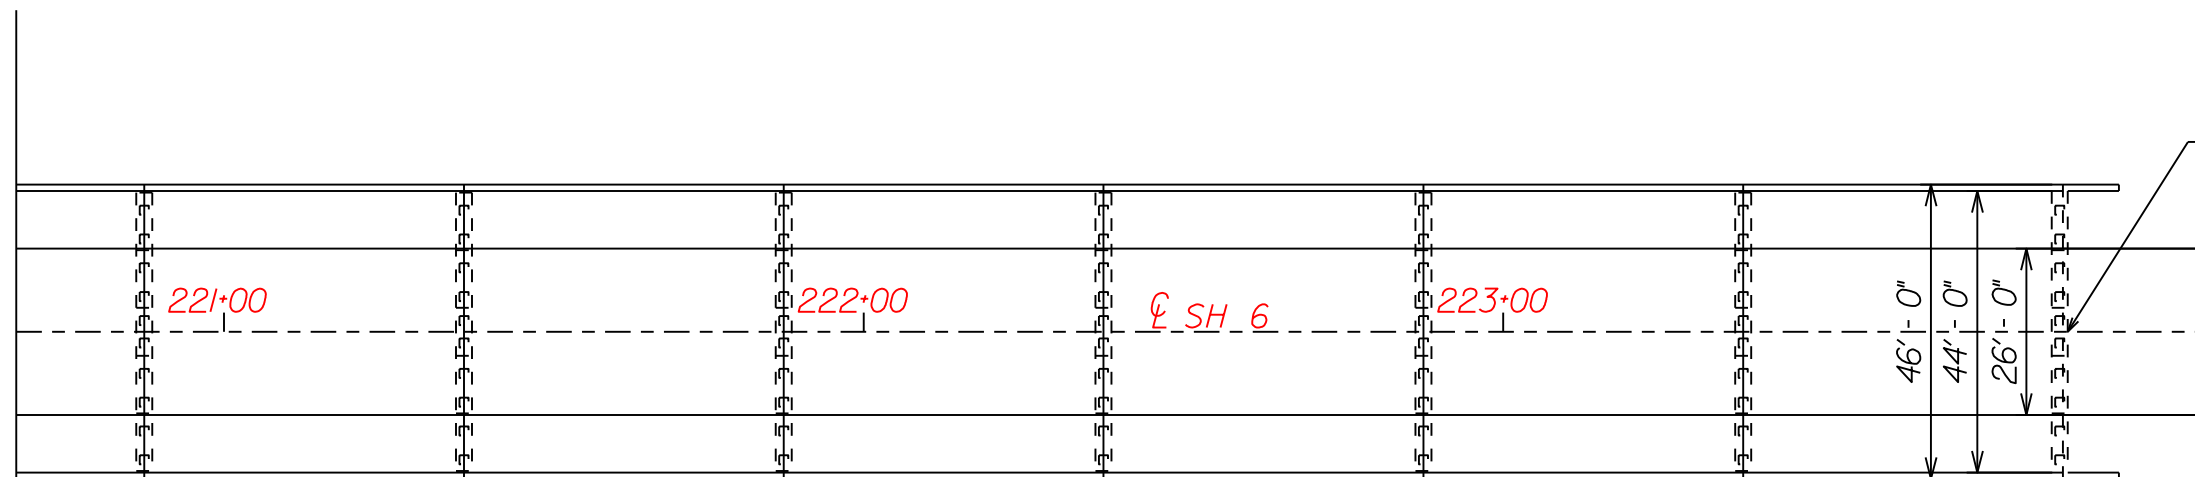

End Sta. 223+88.25

This document is released for informational purposes under the authority of:
 Dan A. Hohmann, P.E.
 Engineering Seal # 97588
 8/18/2021
 It is not to be used for regulatory approval, permit, bidding, or construction purposes.

DATE: 14 AUG 2019
 COUNTY: 047
 CONT-SEC: 0257-05
 STR: 028



SLIPPED BEARING PAD AT BENT 2
Looking W

IMG. 154

Note: Slipped bearing pad at bent 2 beneath second beam from South.

PHOTO #1



SPALL AT BENT 4 PILE
Looking n

IMG. 146

Note: Spall at base of 6th pile from North at bent 4 with exposed rebar.

PHOTO #2

Sta. 217+46.75 - 223+88.25
 13 Span Steel I-Beam Bridge
 On Conc Substructure widened
 with PS Conc I-Beams

DATE: 8/18/2021 4:33:46 PM
 FILE: ...SH 6 LEON RIVER.dwg

SH 6 @
 LEON RIVER
 230470025705028
 COMANCHE CO.



CONT	SECT	JOB	HIGHWAY
0288	01	039, etc.	SH 16, etc.
DIST	COUNTY	SHEET NO.	
BWD	COMANCHE, ETC.	111	